

634-011

Dart Aerospace Ltd.

Date: Thursday, 06/11/2008 2:19:26 PM
 User: Julie Dawson

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : SKID TUBE ASSEMBLY
Job Number : 43236A	
Estimate Number : 10023	
P.O. Number :	Part Number : D205634041
This Issue : 06/11/2008 S.O. No. :	Drawing Number : D2580 REV D
Prsht Rev. : NC	Project Number : N/A
First Issue : / / Type : SKIDTUBES	Drawing Revision : D
Previous Run : 43083	Material :
Written By :	Due Date : 19/11/2008 Qty: 1 Um: Each
Checked & Approved By : <u>JLD 08.11.06</u>	
Comment : Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30 KJ	
Est Rev: O 06.02.28 Added paperwork EC	
Est Rev:P 07-07-09 SS Wearplates & Gaskets JLM	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------

**Comment:** DOCUMENT CONTROL

Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG002

N/A *JD*

2.0	D25001190	Ext'n -I' Beam Tube 4"
-----	-----------	------------------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2500-1-190	Skid Tube Extrusion	B-40150

AWM
5-11-07

3.0	D2596	Web, 205 Skidtube
-----	-------	-------------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2596	205 Web	B-43108

43250? AWM
5-11-07

4.0	SKIDTUBES 1	SKIDTUBESS RESOURCE 1
-----	-------------	-----------------------

**Comment:** LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends

3-Acid etch and Alodine tube per QSI 005 4.1

AWM
5-11-07

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: 06/11/2008 2:19:26 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43236A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

IT 08-11-07

6.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580without cutting fluid

3-Countersink holes as per Dwg D2580without cutting fluid

4-Deburr and blow out all chips from inside of tube

5-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 109449

Sikaflex expire date: 8-12-1

Start Time: 10:40 Date: 8-11-7

Fin Time: 745 Date: 8-11-11

IT 08-11-07

SL 8-11-7

7.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580

DP 8-11-11

8.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends

2-Prepare tube for welding, remove alodine as required.

JB 8-11-11

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng		Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 06/11/2008 2:19:26 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43236A

Part Number: D205634041

Job Number:



Seq. #: Machine Or Operation: Description :

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 08/11/11

10.0

D25763

Step (maching detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2576-3	Step	<i>238392</i>

BE 08/11/11

11.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
20	D2579	Spacers	<i>41432</i>

BE 08/11/11

12.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

2-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

m109813 BE 08/11/11

3-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill.

A/R

Aluminum Rod

m109813 BE 08/11/11

4-Grind welds as per Dwg D2580 Grind flush ridge made from bending

5-Drill holes for wearplates using DT 8217 & DT8937 Open holes to 19/64", adjust stopper not to hit web. Debur

6-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Debur holes

7-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

8-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

JD
8-11-12

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 06/11/2008 2:19:26 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43236A

Part Number: D205634041

Job Number:



Seq. #: Machine Or Operation: Description:

13.0

QC10

VISUAL INSPECTION OF GROUND WELDS



08-11-12 (1)

Comment: VISUAL INSPECTION OF GROUND WELDS

14.0

QC5

INSPECT WORK TO CURRENT STEP



08-11-12 (1)

Comment: INSPECT WORK TO CURRENT STEP

15.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

Ed 08/11/21 (1)

16.0

POWDER COATING

POWDER COATING



M 109152

(1X)

Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

10:30
325
11:00

M-L 08/11/21

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

08-11-25 (21)

18.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Cap

Batch: 1342343

YLS

19.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M1100188

YLS

08-11-25 (21)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Thursday, 06/11/2008 2:19:26 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43236A

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

20.0	AN960JD10L	Washer
------	------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M1105793

JD

21.0	ALS71032130	Insert
------	-------------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

Insert

Batch: M1105819

X

JD

22.0	AN3C4A	BOLT
------	--------	------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

BOLT

Batch: M1109798

JD

23.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 50.0000 Each(s)/Unit Total : 50.0000 Each(s)

washer

Batch: M1109798

JD

24.0	D356613	Gasket
------	---------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B412147

JD

25.0	D35665	Gasket
------	--------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B41467

JD

26.0	D35661	Gasket
------	--------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

GASKET

Batch: B413264

JD

08.11.25 (X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Thursday, 06/11/2008 2:19:26 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43236A

Part Number: D205634041

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

27.0	D356413	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B 41933

JH

28.0	D356411	Wearshoe
------	---------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B 413192

JH

29.0	D35649	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B 42258

JH

30.0	D35645	Wearshoe
------	--------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B 42236

JH

31.0	D25943	O-Ring, 205 Skidtube
------	--------	----------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

O-Ring

Batch: B 29908

JH

32.0	D25941	Plug, 205 Skidtube
------	--------	--------------------



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Plug

Batch: B 41434

JH

33.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

M109449

JH

08-11-26

KL

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

Date: Thursday, 06/11/2008 2:19:26 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 43236A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

1 Sikaflex expire date: 08/11

2 Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3 Inspect for foreign object per QSI 024

4 Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 M109449

Sikaflex expire date: 08/11

5 Wing Walk as per Dwg D2580 and QSI 005 4.4

Batch: 109917

08-11-26 (K)

34.0

QC5

INSPECT WORK TO CURRENT STEP



08/11/26 (11)



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

35.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location: B

PPP Rev: PP

43236A

8/11/27

Label check (K)

SS SP

36.0

QC21

FINAL INSPECTION/W/O RELEASE



08/12/01 (K)

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-11-27

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)							
DATE	STEP	Description of NC Section A	Corrective Action		Section B		Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date				

NOTE: Date & initial all entries

DART

DESIGN #	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED #	APPROVED #	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 #

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/- 291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 43236A

Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

RELEASED
07-06-28-4

Diagram illustrating the grinding locations for the propeller. The diagram shows a cross-section of the propeller with the following labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{4}$

Diagram of a circular component with various parts labeled:

- DRILL PRIOR TO D2855 CAP INSTALLATION (2 PLACES)
- SEAL WITH SIKAFLEX-241/-291
- AN3-SA BOLT (1)
- AN960/D10L WASHER (1)
- D2855 CAP
- 0.40

Diagram of a wheel assembly with labels:

- D2579 SPACER
- D2596 WEB (REF)
- 7-1032-130 (REF) (TYP 50 PLACES)
- AFTER PERFORM
 1. CHA
 2. INS
 3. WE
 4. C'B

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO $\phi 0.437$ X 1.00 DEEP

[illegible]

D3560-041 ASSEMBLY DETAIL

0.5 1.5 1.5 D

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

WELD AS PER DETAIL B

REFER TO DETAIL C

8

P P P P P P P

D3566-1 D3566-5 D3566-1 D3566-13





D3564-11 D3564-5 D3564-9 D3564-13

AN3C4A BOLT (1)
AN960C10L WASHER (1)
(50 PLACES)

DESIGN	DRAWN BY
--------	----------

i) **FINISH:** ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN 	DRAWN BY 
CHECKED 	APPROVED 
DATE 07.02.27	

DRAWING NO.	REV. D
D2580	SHEET 2 OF 3
TITLE	SCALE
205 SKIDTUBE ASSEMBLY	1:24

Diagram of a circular cross-section of a pipe with four vertical stiffeners. The stiffeners are spaced 3.500 units apart. The distance from the centerline to the outer edge of the stiffeners is 1.750 units.

RELEASED
07-16-28

Diagram illustrating the grinding locations for the D2576-3 step. The diagram shows a cross-section of the step with the following labels:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{4}$

#0.208

DRILL PRIOR TO D2855 CAP
INSTALLATION (2 PLACES)

SEAL WITH
SIKAFLEX-241/-291

AN3-5A BOLT (1)
AN96JD10L WASHER (1)
(2 PLACES)

SEE NOTE ii)

D2855 CAP

0.40

HATCH

HULL

D2579 SPACER
 D2596 WEB (REF)
 S7-1032-130 (REF)
 (TYP 50 PLACES)

AFTER PERFORM
 1. CHA
 2. INS
 3. WEI
 4. C'B

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE
WITH THE SPACER AT THIS LOCATION

[illegible]

Technical drawing of a curved structural member, likely a propeller shaft, showing dimensions and callouts. The drawing includes the following details:

- Overall Dimensions:**
 - Total length: 51.340
 - Distance from left end to center of first hole: 39.580
 - Distance between centers of two holes: 5.915
 - Distance from right end to center of second hole: 32.0 ± 1.0
- Hole Dimensions and Locations:**
 - Left hole: Diameter $\phi 0.508$ (8 PLACES), located 1.4 from the left end.
 - Right hole: Diameter $\phi 0.640$, located 20.0 from the right end.
 - Reference dimensions for hole placement: 5.338 (REF) and 3.630 (REF).
- Other Dimensions:**
 - Left end offset: 5.985
 - Right end offset: 11.0
 - Distance between hole and tangent point (left): 13.4
 - Distance between hole and tangent point (right): 1.0
- Callouts:**
 - Callout 4: Points to the left end of the shaft.
 - Callout 4: Points to the right end of the shaft.

WELD AS PER DETAIL F

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

NO C'BORE NO PLUG

8

1.5

1.5

H

P P P P P P P

NO C'BORE NO PLUG

D3566-1

D3566-5

D3566-1

D3566-13

D3564-11

D3564-5

D3564-9

D3564-13

AN3C4A BOLT (1)

AN960C10L WASHER (1)

(50 PLACES)

DESIGN	DRAWN BY
--------	----------

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

07 03 37

DART AEROSPACE LTD.
HAMPSHIRE, ONTARIO, CANADA

REV. D

SHEET 3 OF 3

SCALE

205 SKIDTUBE ASSEMBLY

1:24